


INSTRUCTION

LINEDO
951290.843.400.000





RZB
LIGHTING

≈ 220 - 240 V 0/50/60 Hz IP 54 IK03



Umgebungstemperatur /
temperature ambiante
=> -25 °C ... + 50 °C

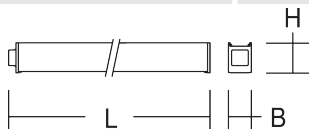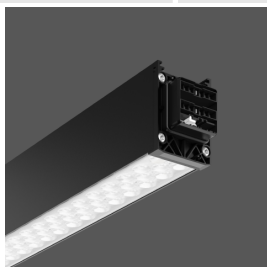

L 1163, B 58, H 76



LED



2,625 kg

Φ [lm]

3400

P [W]

21

P

2 x 19,7 W

CCT [K]

4000

CRI

80

RG

RG 1

EEK

A++

EEK

A++



41 A / 124 µs

B₁₀ [St.]

16

B₁₆ [St.]

26

C₁₀ [St.]


32

C₁₆ [St.]

51

P_f

0,98

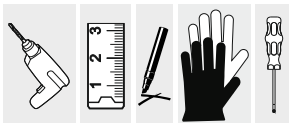


INSTRUCTION
WARTUNGSPLAN/
MAINTENANCE
SCHEDULE

DIN EN 61340-5-1




EN 12464
EN 13201



EN 12464
EN 13201





INSTRUCTION
WARTUNGSPLAN/
MAINTENANCE
SCHEDULE



<100%


100%

EN 12464








1

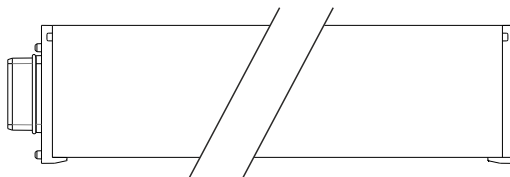




2a

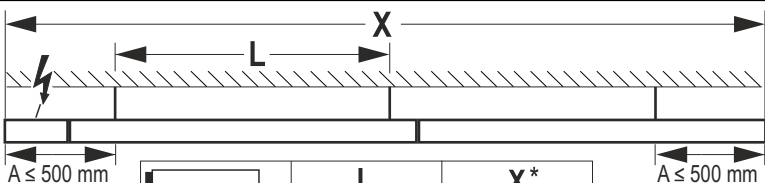

	L	X*
4547 mm	≤ 4500 mm	≤ 60000 mm
2291 mm	≤ 2270 mm	≤ 50000 mm

* $R_{PE} < 0,5 \Omega$
EN 60598




2b

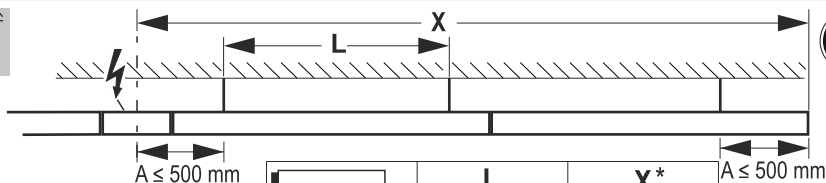

	L	X*
4547 mm	≤ 4500 mm	≤ 60000 mm
2291 mm	≤ 2270 mm	≤ 50000 mm



* $R_{PE} < 0,5 \Omega$
EN 60598

2c

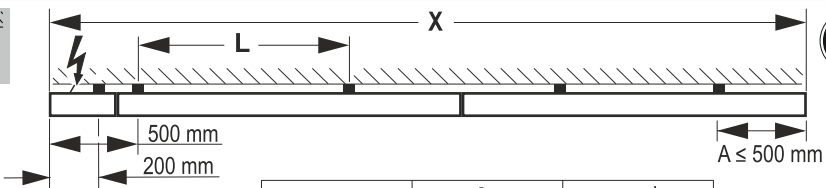

	L	X*
4547 mm	≤ 2200 mm	≤ 60000 mm
2291 mm	≤ 1100 mm	≤ 50000 mm

* $R_{PE} < 0,5 \Omega$
EN 60598

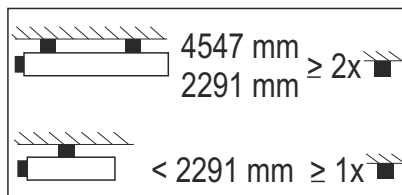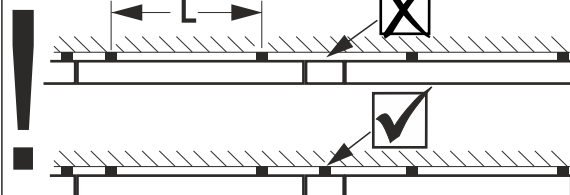



2d

210 mm

500 mm

$A \leq 500 \text{ mm}$

	L	* X
4547 mm	$\leq 2200 \text{ mm}$	$\leq 60000 \text{ mm}$
2291 mm	$\leq 1100 \text{ mm}$	$\leq 50000 \text{ mm}$

$\leq 7 \text{ kg}$

$2x$

* $R_{PE} < 0,5 \Omega$
EN 60598

Diagram showing the correct and incorrect way to install the fixture. The correct way is to use a screwdriver to tighten the screws. The incorrect way is to use a screwdriver to tighten the screws by hand.

4547 mm
2291 mm $\geq 2x$

$< 2291 \text{ mm} \geq 1x$

3

Shopping cart icon +

Diagram showing the correct and incorrect way to install the fixture. The correct way is to use a screwdriver to tighten the screws. The incorrect way is to use a screwdriver to tighten the screws by hand.

4

$\varnothing 5,2$

SW 14

Diagram showing the correct and incorrect way to install the fixture. The correct way is to use a screwdriver to tighten the screws. The incorrect way is to use a screwdriver to tighten the screws by hand.

5



24 mm

SW 7



Diagram showing the correct and incorrect way to install the fixture. The correct way is to use a screwdriver to tighten the screws. The incorrect way is to use a screwdriver to tighten the screws by hand.







6a

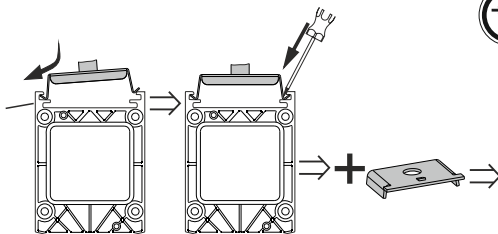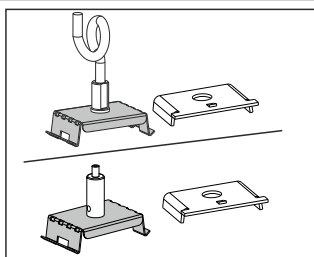




6b

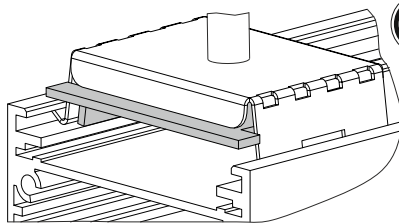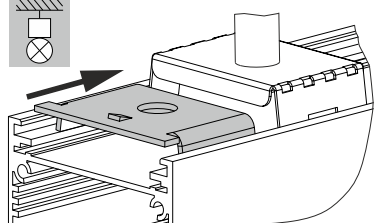



7


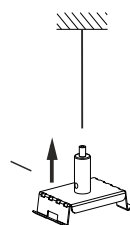
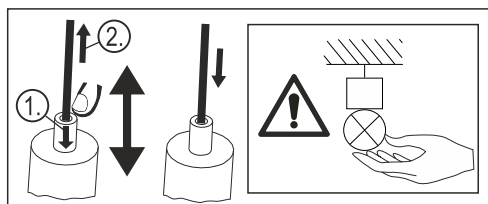








8

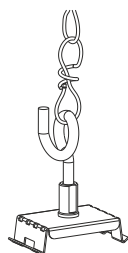
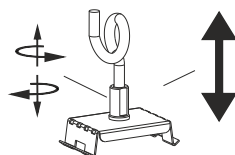


9a

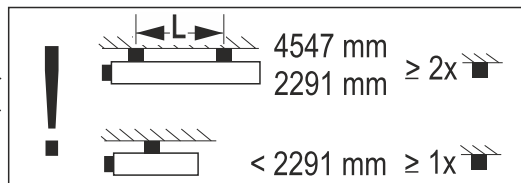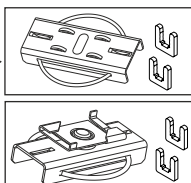

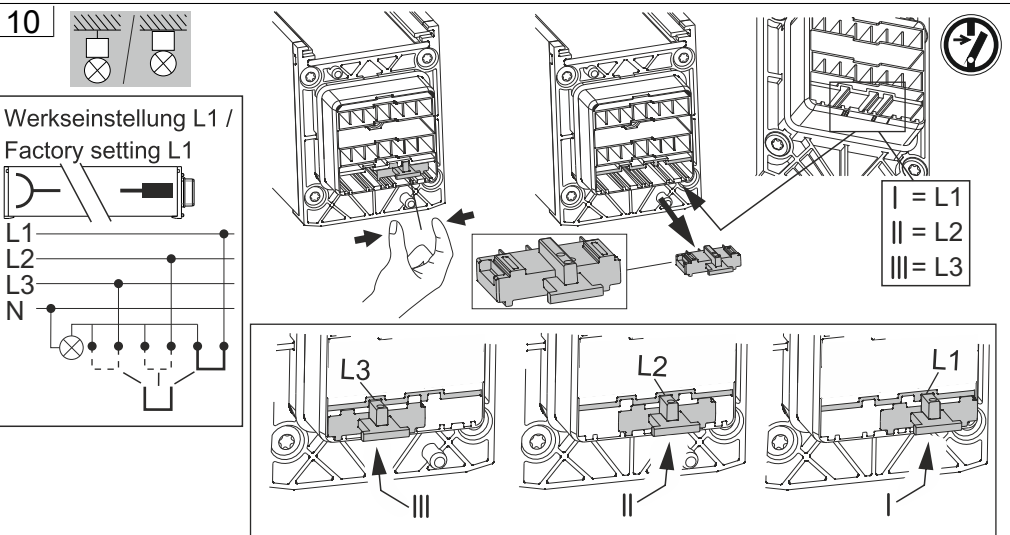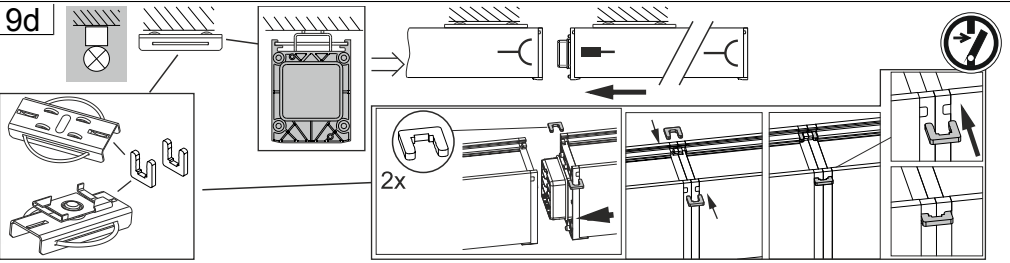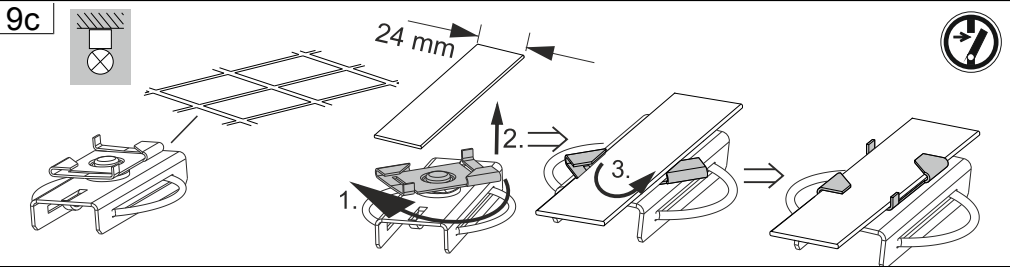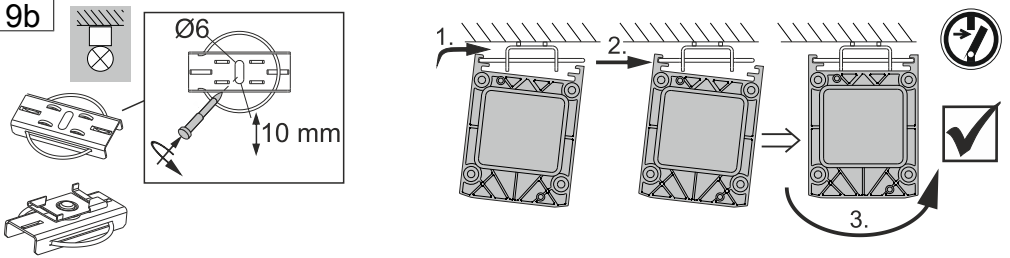

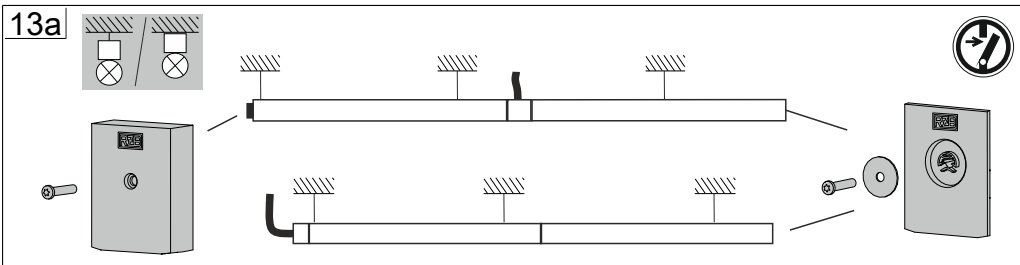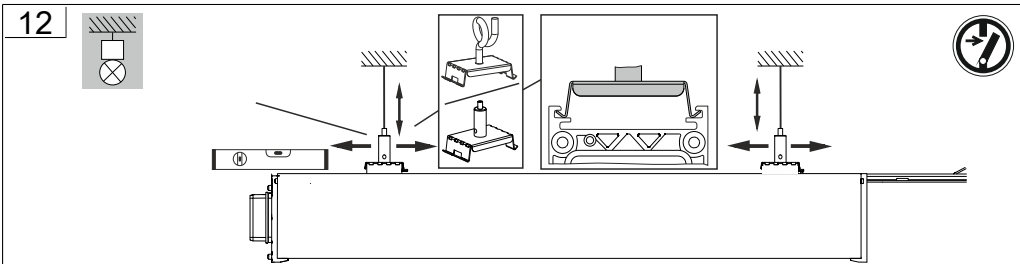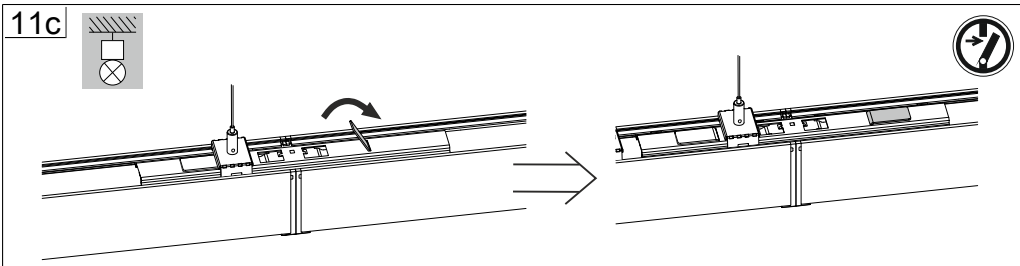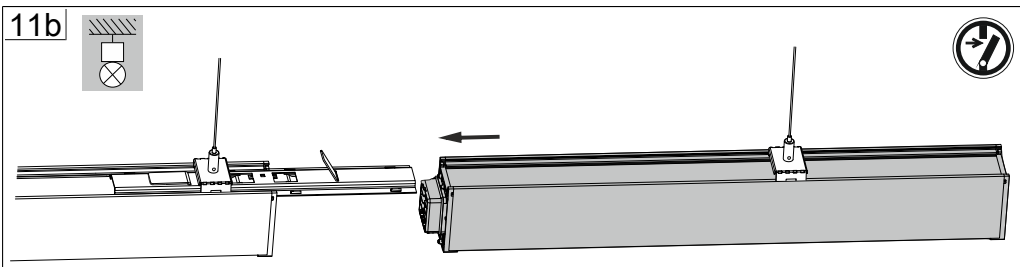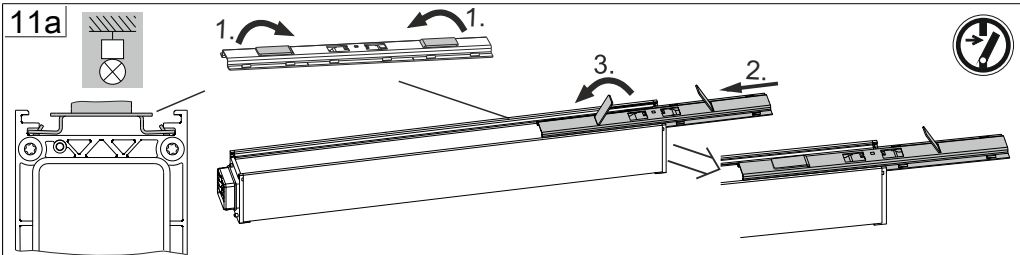

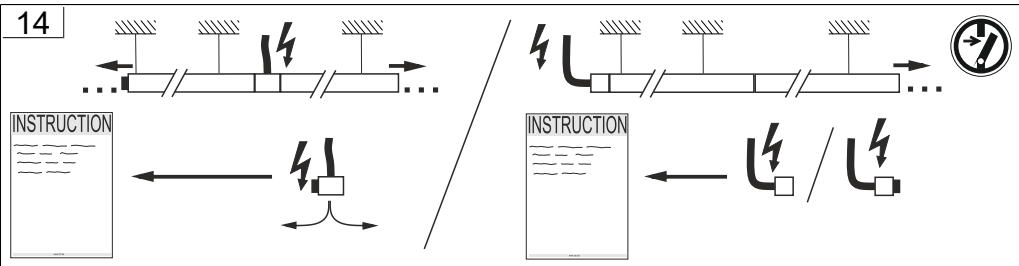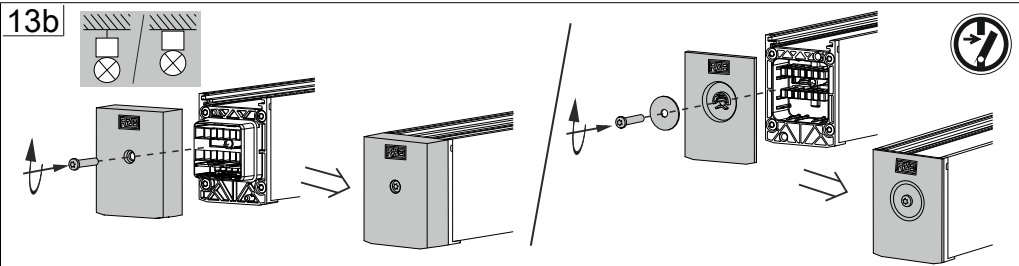




Bei Fragen zu unseren Symbolen,
besuchen Sie folgende Webseite:


If you have any questions about our
signs, visit the following website:




www.rzb.de/fileadmin/assets/downloads/PDF/RZB_Symbolklaerung.pdf




Pendelmontage / Pendant mounting
Einspeisung von der Seite / Feed from the side



Deckenmontage / Ceiling mounting
Einspeisung von der Seite / Feed from the side



Pendelmontage / Pendant mounting
Einspeisung von Oben / Feed from above



Deckenmontage / Ceiling mounting
Einspeisung von Oben / Feed from above

Stecker / Plug







Buchse / Socket



Pendelmontage /
Pendant mounting



Deckenmontage /
Ceiling mounting

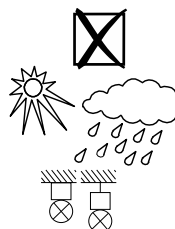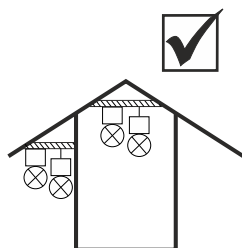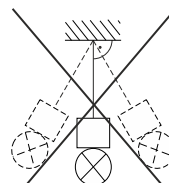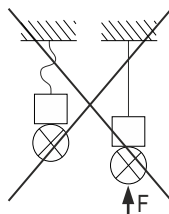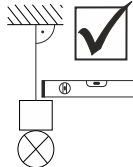

Hinweis zum Einsatz von Leuchten mit -Kennzeichnung nach EN 60598-2-24

Reference for application of lumiaires with - marking according to EN 60598-2-24



IP 4x

Umgebung ohne Staubablagerung
Environment without dust deposit



IP 5x


Umgebung mit nicht elektrisch leitender Staubablagerung
Environment with non-electrically conductive dust deposit



IP 6x

Umgebung mit elektrisch leitender Staubablagerung
Environment with electrically conductive dust deposit



	982678.003	Einspeisung Feed	L 312, B 58, H 76	630 g
	982678.003.1	Einspeisung Feed	L 330, B 58, H 76	728 g
	982698.003	Einspeisung Feed	L 330, B 58, H 76	850 g
	982698.003.1	Einspeisung Feed	L 312, B 58, H 76	850 g
	982698.003.2	Einspeisung Feed	L 349, B 58, H 76	850 g
	982661.000	Pendelset Pendant kit	, LP 1500	56 g
	982662.000	Pendelset Pendant kit	, LP 1500	240 g
	982663.000	Befestigungsset Fixture	L 33, B 54,	63 g
	982664.000	Befestigungsset Fixture	L 33, B 54,	39,1 g
	982665.000	Pendelset Pendant kit	, LP 1500	80 g
	982717.000	Pendelset Pendant kit	, LP 5000	190 g
	982718.000	Pendelset Pendant kit	L 54, B 30, H 14, LP 5000	240 g



	982719.000	Pendelset Pendant kit	L 54, B 30, H 42, LP 5000	270 g
	982580.010	Deckenmontageset Ceiling surface mounting kit	L 70, B 28, H 16	44 g
	982666.000	Befestigungsset Fixture	L 70, B 54, H 22	25 g
	982699.003	Endkappe End cap	L 16, B 58, H 76	21,5 g
	982700.003	Endkappe End cap	L 23, B 58, H 76	31 g
	982680.000	Verbinder Connector	L 300, B 48, H 9	181 g



RZB - Rudolf Zimmermann, Bamberg GmbH
Rheinstraße 16
96052 Bamberg

☎ 0951/7909-0
Fax: 0951/7909-198

E-mail: info@rzb-leuchten.de